

374/375/376

Clamp Meter

Calibration Manual

LIMITED WARRANTY AND LIMITATION OF LIABILITY

Each Fluke product is warranted to be free from defects in material and workmanship under normal use and service. The warranty period is three years and begins on the date of shipment. Parts, product repairs, and services are warranted for 90 days. This warranty extends only to the original buyer or end-user customer of a Fluke authorized reseller, and does not apply to fuses, disposable batteries, or to any product which, in Fluke's opinion, has been misused, altered, neglected, contaminated, or damaged by accident or abnormal conditions of operation or handling. Fluke warrants that software will operate substantially in accordance with its functional specifications for 90 days and that it has been properly recorded on non-defective media. Fluke does not warrant that software will be error free or operate without interruption.

Fluke authorized resellers shall extend this warranty on new and unused products to end-user customers only but have no authority to extend a greater or different warranty on behalf of Fluke. Warranty support is available only if product is purchased through a Fluke authorized sales outlet or Buyer has paid the applicable international price. Fluke reserves the right to invoice Buyer for importation costs of repair/replacement parts when product purchased in one country is submitted for repair in another country.

Fluke's warranty obligation is limited, at Fluke's option, to refund of the purchase price, free of charge repair, or replacement of a defective product which is returned to a Fluke authorized service center within the warranty period.

To obtain warranty service, contact your nearest Fluke authorized service center to obtain return authorization information, then send the product to that service center, with a description of the difficulty, postage and insurance prepaid (FOB Destination). Fluke assumes no risk for damage in transit. Following warranty repair, the product will be returned to Buyer, transportation prepaid (FOB Destination). If Fluke determines that failure was caused by neglect, misuse, contamination, alteration, accident, or abnormal condition of operation or handling, including overvoltage failures caused by use outside the product's specified rating, or normal wear and tear of mechanical components, Fluke will provide an estimate of repair costs and obtain authorization before commencing the work. Following repair, the product will be returned to the Buyer transportation prepaid and the Buyer will be billed for the repair and return transportation charges (FOB Shipping Point).

THIS WARRANTY IS BUYER'S SOLE AND EXCLUSIVE REMEDY AND IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. FLUKE SHALL NOT BE LIABLE FOR ANY SPECIAL, INDIRECT, INCIDENTAL OR CONSEQUENTIAL DAMAGES OR LOSSES, INCLUDING LOSS OF DATA, ARISING FROM ANY CAUSE OR THEORY.

Since some countries or states do not allow limitation of the term of an implied warranty, or exclusion or limitation of incidental or consequential damages, the limitations and exclusions of this warranty may not apply to every buyer. If any provision of this Warranty is held invalid or unenforceable by a court or other decision-maker of competent jurisdiction, such holding will not affect the validity or enforceability of any other provision.

Fluke Corporation
P.O. Box 9090
Everett, WA 98206-9090
U.S.A.

Fluke Europe B.V.
P.O. Box 1186
5602 BD Eindhoven
The Netherlands

11/99

To register your product online, visit register.fluke.com

Table of Contents

| Title | Page |
|-----------------------------------|-------------|
| Introduction..... | 1 |
| Contact Fluke..... | 1 |
| Safety Information..... | 2 |
| The Meter..... | 5 |
| Specifications..... | 5 |
| Electrical Specifications..... | 5 |
| Mechanical Specifications..... | 8 |
| Environmental Specifications..... | 8 |
| Performance Tests..... | 9 |
| Calibration Adjustment..... | 10 |
| Required Equipment..... | 10 |
| Adjustment Procedure..... | 11 |
| Maintenance..... | 15 |
| Clean the Product..... | 15 |
| Battery Replacement..... | 15 |
| User Replaceable Parts..... | 16 |

List of Tables

| Table | Title | Page |
|--------------|-----------------------------|-------------|
| 1. | Symbols..... | 4 |
| 2. | Performance Tests..... | 9 |
| 3. | Required Equipment..... | 10 |
| 4. | Adjustment Procedure..... | 13 |
| 5. | User Replaceable Parts..... | 16 |

List of Figures

| Figure | Title | Page |
|---------------|--------------------------------|-------------|
| 1. | The Meter | 5 |
| 2. | Position Sensitivity..... | 6 |
| 3. | Calibration Activation..... | 11 |
| 4. | Current Calibration Setup..... | 12 |
| 5. | Changing the Batteries | 16 |

Introduction

⚠️⚠️ Warning

Read "Safety Information" before you use the Product.

This manual explains the Calibration Adjustment for the 374, 375, and 376 Clamp Meters (the Product). Please see the *374/375/376 Users Manual* for usage information.

Contact Fluke

To contact Fluke, call one of the following telephone numbers:

- Technical Support USA: 1-800-44-FLUKE (1-800-443-5853)
- Calibration/Repair USA: 1-888-99-FLUKE (1-888-993-5853)
- Canada: 1-800-36-FLUKE (1-800-363-5853)
- Europe: +31 402-675-200
- Japan: +81-3-3434-0181
- Singapore: +65-738-5655
- China: +86-400-810-3435
- Anywhere in the world: +1-425-446-5500

Or, visit Fluke's website at www.fluke.com.

To register your product, visit <http://register.fluke.com>.

To see, print, or download the latest manual supplement, visit <http://us.fluke.com/usen/support/manuals>.


Safety Information

A **Warning** identifies conditions and actions that pose hazard(s) to the user. A **Caution** identifies conditions and procedures that could cause Meter damage, equipment under test damage, or permanent loss of data.

Symbols used on the Product and in this manual are explained in Table 1.

Warning

To prevent possible electrical shock, fire, or personal injury:

- Use the product only as specified, or the protection supplied by the Product can be compromised.
- Examine the case before you use the Product. Look for cracks or missing plastic. Carefully look at the insulation around the terminals.
- Do not measure current while the test leads are in the input jacks.
- The battery door must be closed and locked before you operate the Product.
- Remove all probes, test leads, and accessories before the battery door is opened.
- Do not use test leads if they are damaged. Examine the test leads for damaged insulation, exposed metal, or if the wear indicator shows. Check test lead continuity.
- Do not use the Product if it operates incorrectly.
- Do not use the Product around explosive gas, vapor, or in damp or wet environments.
- Use only type AA batteries, properly installed in the Product case, to power the Product.
- Hold the Product behind the tactile barrier. See Figure 1, ①.
- Replace the batteries when the low battery indicator () shows to prevent incorrect measurements.
- Use only specified replacement parts.
- Have an approved technician repair the Product.
- Do not touch voltages >30 V ac rms, 42 V ac peak, or 60 V dc.
- Do not apply more than the rated voltage, between the terminals or between each terminal and earth ground.
- Keep fingers behind the finger guards on the probes.
- Connect the common test lead before the live test lead and remove the live test lead before the common test lead.
- Do not work alone.


 







 




- Use caution around bare conductors or bus bars. To prevent electrical shock, do not touch the conductor.
- Comply with local and national safety codes. Use personal protective equipment (approved rubber gloves, face protection, and flame-resistant clothes) to prevent shock and arc blast injury where hazardous live conductors are exposed.
- Disconnect power and discharge all high-voltage capacitors before you measure resistance or continuity.
- For the 374 and 375, do not measure ac/dc current in circuits carrying more than 1000 V or 600 A with the Product Jaw.
- For the 376, do not measure ac/dc current in circuits carrying more than 1000 V or 1000 A with the Product Jaw.
- Do not measure ac current in circuits carrying more than 1000 V or 2500 A with the Flexible Current Probe.
- Do not apply the Flexible Current Probe around or remove from HAZARDOUS LIVE conductors.
- Do not use the flexible current sensor if the inner contrasting insulation color is showing.
- Take special care during fitting and removal of the Flexible Current Probe. De-energize the installation under test or wear suitable protective clothing.
- Do not operate the product with covers removed or the case open. Hazardous voltage exposure is possible.
- When batteries are changed, ensure that the calibration seal in the battery compartment is not damaged. If damaged, the Product may not be safe for use. Return the Product to Fluke for replacement of the seal.
- Do not exceed the Measurement Category (CAT) rating of the lowest rated individual component of a product, probe, or accessory.
- Measure a known voltage first to make sure that the Product operates correctly.

⚠ Caution

To prevent possible damage to the product or to equipment under test:

- Use the correct terminals, function, and range for measurements.
- Clean the case and accessories with a damp cloth and mild detergent only. Do not use abrasives or solvents.

Table 1. Symbols

| Symbol | Meaning | Symbol | Meaning |
|---|---|---|--|
|  | AC (Alternating Current) |  | Earth ground |
|  | DC (Direct Current) |  | Do not dispose of this product as unsorted municipal waste. Go to Fluke's website for recycling information. |
|  | Hazardous voltage |  | Conforms to European Union directives. |
|  | Risk of Danger. Important information. See Manual. |  | Conforms to relevant North American Safety Standards. |
|  | Battery. Low battery when shown on display. |  | Double insulated |
|  | Examined and licensed by TÜV Product Services. |  | Conforms to relevant Australian standards. |
|  | Application around and removal from HAZARDOUS LIVE conductors is permitted. |  | Do not apply to or remove from HAZARDOUS LIVE conductors. |
| CAT III | IEC Measurement Category III CAT III equipment has protection against transients in equipment in fixed-equipment installations, such as distribution panels, feeders and short branch circuits, and lighting systems in large buildings. | CAT IV | IEC Measurement Category IV CAT IV equipment has protection against transients from the primary supply level, such as an electricity Meter or an overhead or underground utility service. |

Note

The Measurement Category (CAT) and voltage rating of any combination of test probe, test probe accessory, current clamp accessory, and the Meter is the LOWEST rating of any individual component.

The Meter

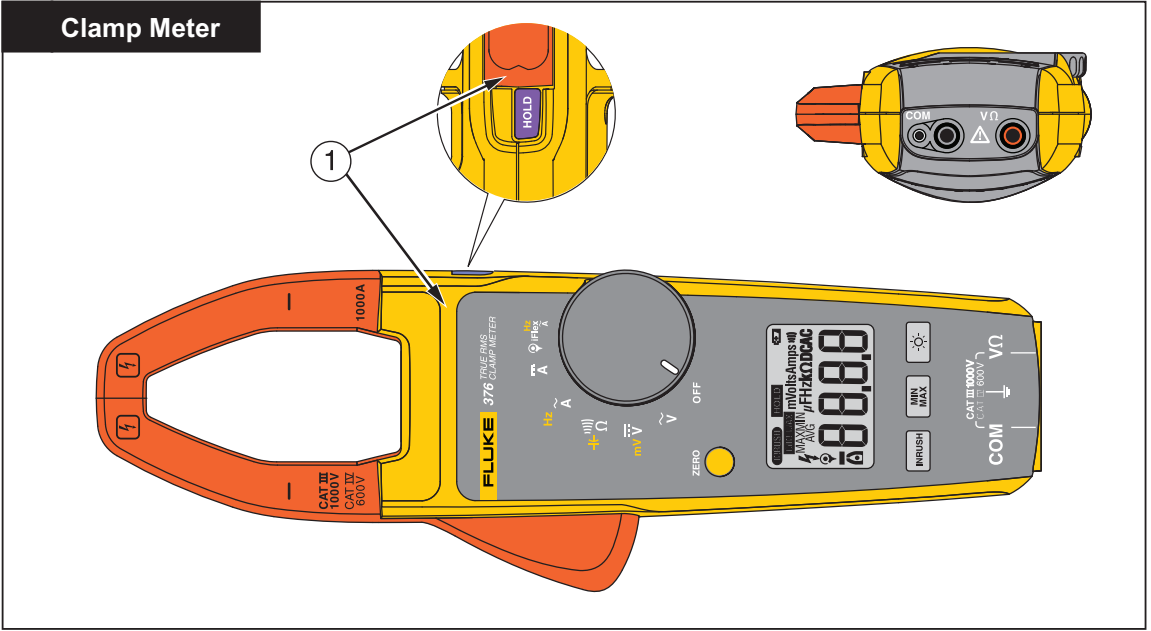


fig01.eps

Figure 1. The Meter

Specifications

Electrical Specifications

AC Current via Jaw

| | |
|-------------------------------|-------------------------------|
| Range | |
| 374 and 375 | 600.0 A |
| 376..... | 999.9 A |
| Resolution | 0.1 A |
| Accuracy | 2 % ± 5 digits (10-100 Hz) |
| | 2.5 % ± 5 digits (100-500 Hz) |
| Crest Factor (50/60 Hz) | 3 @ 500 A (375 and 376 only) |
| | 2.5 @ 600 A |
| | 1.42 @1000 A (376 only) |
| | Add 2 % for C.F. > 2 |

AC Current via Flexible Current Probe

| | |
|------------------------------|----------------------------------|
| Range | 2500 A |
| Resolution | |
| 374 and 375 | 0.1 A (≤ 1000 A) |
| | 1 A (≤ 2500 A) |
| 376 | 0.1 A (≤ 999.9 A) |
| | 1 A (≤ 2500 A) |
| Accuracy | 3 % ±5 digits (5 – 500 Hz) |
| Crest Factor (50/60Hz) | 3.0 at 1100 A (375 and 376 only) |
| | 2.5 at 1400 A |
| | 1.42 at 2500 A |
| | Add 2 % for C.F. > 2 |

Position Sensitivity

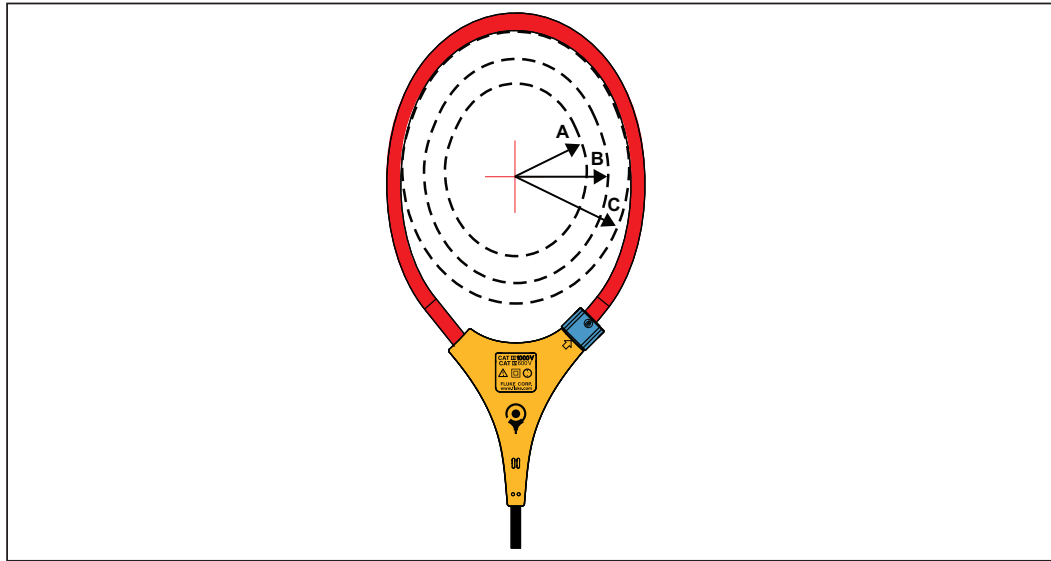


Figure 2. Position Sensitivity

ghn12.eps

| Distance from Optimum | i2500-10 Flex | i2500-18 Flex | Error |
|-----------------------|------------------|------------------|---------|
| A | 0.5 in (12.7 mm) | 1.4 in (35.6 mm) | ± 0.5 % |
| B | 0.8 in (20.3 mm) | 2.0 in (50.8 mm) | ± 1.0 % |
| C | 1.4 in (35.6 mm) | 2.5 in (63.5 mm) | ± 2.0 % |

Measurement uncertainty assumes centralized primary conductor at optimum position, no external electrical or magnetic field, and within operating temperature range.

DC Current

Range

374 and 375 600.0 A

376 999.9 A

Resolution 0.1 A

Accuracy 2 % ± 5 digits

AC Voltage

Range

374 and 375 600.0 V

376 1000 V

Resolution

374 and 375 0.1 V

376 0.1 V (≤ 600.0 V)

1 V (≤ 1000 V)

Accuracy 1.5 % ± 5 digits (20 – 500 Hz)

DC Voltage

| | |
|-------------------|---|
| Range | |
| 374 and 375 | 600.0 V |
| 376 | 1000 V |
| Resolution | |
| 374 and 375 | 0.1 V |
| 376 | 0.1 V (≤ 600.0 V) 1 V (≤ 1000 V) |
| Accuracy | 1 % \pm 5 digits |

mV dc

| | |
|-------------------|--------------------|
| Range | |
| 375 and 376 | 500.0 mV |
| Resolution | 0.1 mV |
| Accuracy | 1 % \pm 5 digits |

Frequency via Jaw

| | |
|---------------------|--|
| Range | |
| 375 and 376 | 5.0 - 500.0 Hz |
| Resolution | 0.1 Hz |
| Accuracy | 0.5 % \pm 5 digits |
| Trigger Level | 5 – 10 Hz, ≥ 10 A 10 – 100 Hz, ≥ 5 A 100 – 500 Hz, ≥ 10 A |

Frequency via Flexible Current Probe

| | |
|---------------------|---|
| Range | |
| 375 and 376 | 5.0 – 500.0 Hz |
| Resolution | 0.1 Hz |
| Accuracy | 0.5 % \pm 5 digits |
| Trigger Level | 5 – 20 Hz, ≥ 25 A 20 – 100 Hz, ≥ 20 A 100 – 500 Hz, ≥ 25 A |

Resistance

| | |
|-------------------|---|
| Range | |
| 374 | 6000 Ω |
| 375 and 376 | 60 k Ω |
| Resolution | |
| 374 | 0.1 Ω (≤ 600 Ω) 1 Ω (≤ 6000 Ω) |
| 375 and 376 | 0.1 Ω (≤ 600 Ω) 1 Ω (≤ 6000 Ω) 10 Ω (≤ 60 k Ω) |
| Accuracy | 1 % \pm 5 digits |

Capacitance

| | |
|------------------|---|
| Range | 1000 μ F |
| Resolution | 0.1 μ F (≤ 100 μ F) 1 μ F (≤ 1000 μ F) |
| Accuracy | 1 % \pm 4 digits |

Performance Tests

⚠️⚠️ Warning

To prevent possible electrical shock, fire, or personal injury, do not perform the performance test procedures unless the Product is fully assembled.

The following performance tests verify the complete operation of the Product and check the accuracy of each function against the Product's specifications. See Table 2. If the Product fails any part of the test, calibration adjustment and/or repair is indicated. See "Calibration Adjustment".

Table 2. Performance Tests




 




| Test (Switch Position) | Calibrator Output | 374 | 375 | 376 | Meter Reading Limit | |
|--|----------------------|-----|-----|---------|---------------------|----------|
| | | | | | Low | High |
|  AC Volts | 10 V @ 50 Hz | X | X | X | 9.7 V | 10.3 V |
| | 500 V @ 50 Hz | X | X | X | 496.0 V | 504.0 V |
| | 900 V @ 50 Hz | - | - | X | 893.0 V | 907.0 V |
| | 500 V @ 500 Hz | X | X | X | 496.0 V | 504.0 V |
|  DC Volts | -500 V | X | X | X | -503.0 V | -497.0 V |
| | 10 V | X | X | X | 9.7 V | 10.3 V |
| | 500 V | X | X | X | 497.0 V | 503.0 V |
| | 900 V | - | - | X | 895.0 V | 905.0 V |
| | -250 mV | - | X | X | -251.5 V | -248.5 V |
| | 50 mV | - | X | X | 49.5 V | 50.5 V |
| | 250 mV | - | X | X | 248.5 V | 251.5 V |
| 450 mV | - | X | X | 447.5 V | 452.5 V | |
|  Ohms | 60 Ω | X | X | X | 59.5 Ω | 60.5 Ω |
| | 300 Ω | X | X | X | 298.2 Ω | 301.8 Ω |
| | 540 Ω | X | X | X | 537.0 Ω | 543.0 Ω |
| | 3000 Ω | X | X | X | 2982 Ω | 3018 Ω |
| | 5400 Ω | X | X | X | 5370 Ω | 5430 Ω |
| | 30K Ω | - | X | X | 29.82 KΩ | 30.18 KΩ |
| | 54K Ω | - | X | X | 53.70 KΩ | 54.30 Ω |
|  Capacitance | 10 μF | X | X | X | 9.8 μF | 10.2 μF |
| | 500 μF | X | X | X | 496.0 μF | 504.0 μF |
| | 900 μF | X | X | X | 894.0 μF | 906.0 μF |

Table 2. Performance Tests (cont.)

| Test (Switch Position) | Calibrator Output | 374 | 375 | 376 | Meter Reading Limit | |
|---|----------------------|-----|-----|-----|---------------------|---------|
| | | | | | Low | High |
|  AC Amps (with 50- turn Coil) | 0.2 A @ 50 Hz | X | X | X | 9.7 A | 10.3 A |
| | 10 A @ 50 Hz | X | X | X | 495.0 A | 505.0 A |
| | 18 A @ 50 Hz | - | - | X | 891.0 A | 909.0 A |
| | 6 A @ 440 Hz | X | X | X | 296.0 A | 304.0 A |
|  DC Amps (with 50- turn Coil) | 0.2 A | X | X | X | 9.7 A | 10.3 A |
| | 10 A | X | X | X | 495.0 A | 505.0 A |
| | 18 A | - | - | X | 891.0 A | 909.0 A |
|  iFlex Current Probe (with Simulation) | 3 mV @ 50 Hz | X | X | X | 98.2 A | 101.8 A |
| | 30 mV @ 50 Hz | X | X | X | 982 A | 1018 A |
| | 60 mV @ 50 Hz | X | X | X | 1967 A | 2033 A |
| | 75 mV @ 50 Hz | X | X | X | 2460 A | 2540 A |
| | 750 mV @ 500 Hz | X | X | X | 2460 A | 2540 A |
|  iFlex Current Probe (with 50- turn Coil) | 0.2 A @ 50 Hz | X | X | X | 9.6 A | 10.4 A |
| | 10 A @ 50 Hz | X | X | X | 493.0 A | 507.0 A |
| | 18 A @ 50 Hz | X | X | X | 887.0 A | 913.0 A |
| | 6 A @ 440 Hz | X | X | X | 295.2 A | 304.8 A |

Calibration Adjustment

Required Equipment

The equipment listed in Table 3 is required for calibration adjustment.

Table 3. Required Equipment

| Equipment | Required Characteristics | Recommended Model |
|---------------------|--------------------------|--|
| Calibrator | 4.5-digit resolution | Fluke 55xxA Calibrator |
| Wired coil | 50 turns | 5500A/COIL |
| Test Lead for iFlex | | PN 666602 |
| Test Lead for other | | PN 2070140 |
| Power Supply | +3.0 V | Common power supply or a 2 x AA or AAA battery container |

Adjustment Procedure

To adjust Product calibration:

1. Turn the Product over to access the battery compartment door screw.
2. Use a flat-head screwdriver to loosen the battery compartment door screw and lift off the battery compartment door. See Figure 5.
3. Remove the calibration sticker.
4. Connect the Power Supply to the Product battery terminals.
5. Turn the Product ON.
6. Use a small jumper to short the two pads together under the calibration sticker. This will put the Product into calibration mode. See Figure 3.

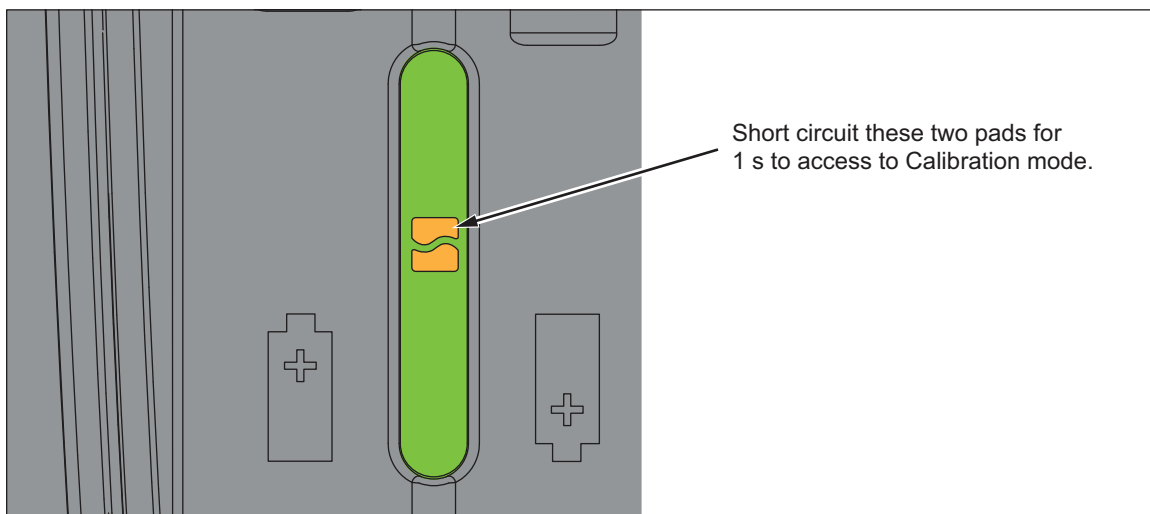


Figure 3. Calibration Activation

ghn51.eps

7. Turn the rotary switch to select the function to be calibrated.
8. Apply the required output from the source to the Product. See Table 4.
9. Wait until each applied output stabilizes.
10. Push **(HOLD)** to confirm the value and move to the next step in the Adjustment Procedure.

For Current calibration, see Figure 4 for connections.

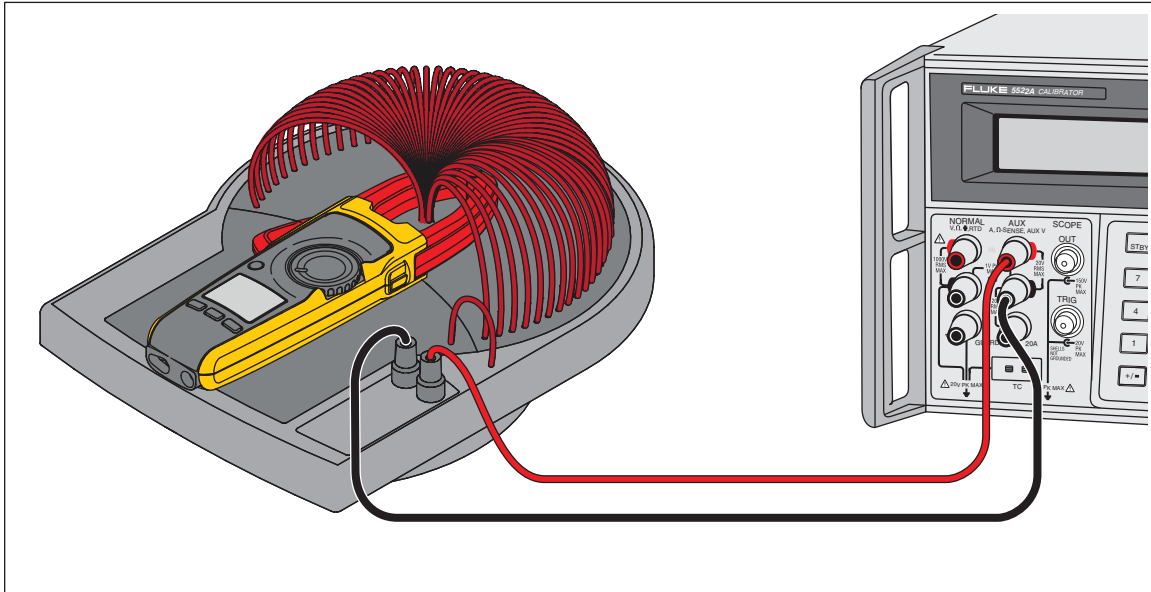


Figure 4. Current Calibration Setup

ghn50.eps

The calibration adjustment is complete.

When the adjustment is complete:

1. Remove the Power Supply.
2. Replace the batteries.
3. Reattach the battery compartment door.
4. Tighten the battery compartment door screw.

Table 4. Adjustment Procedure



 



| Test (Switch Position) | LCD Reading | 374 | 375 | 376 | Calibrator Output |
|--|----------------|-----|-----|-----|-------------------|
|  AC Volts | C-00 | X | X | X | 600 V @ 50 Hz |
| | C-01 | X | X | X | 300 V @ 50 Hz |
| | C-02 | X | X | X | 300 V @ 100 Hz |
| | C-03 | X | X | X | 300 V @ 200 Hz |
| | C-04 | X | X | X | 300 V @ 300 Hz |
| | C-05 | X | X | X | 300 V @ 400 Hz |
| | C-06 | X | X | X | 300 V @ 500 Hz |
| | Save | X | X | X | STBY |
|  DC Volts | C-07 | X | X | X | 0 V |
| | C-08 | X | X | X | 600 V |
| | C-09 | X | X | X | 0 V |
| | C-10 | X | X | X | 0.5 V |
| | Save | X | X | X | STBY |
|  Ohms/Capacitance | C-11 | X | X | X | 0 Ω |
| | C-12 | X | X | X | 600 Ω |
| | C-13 | X | X | X | 660 Ω |
| | C-14 | X | X | X | 6000 Ω |
| | C-15 | - | X | X | 6600 Ω |
| | C-16 | - | X | X | 60000 Ω |
| | C-17 | X | X | X | 0.1 μF |
| | C-18 | X | X | X | 0.5 μF |
| | C-19 | X | X | X | 1.5 μF |
| | C-20 | X | X | X | 110 μF |
| | C-21 | X | X | X | 500 μF |
| | C-22 | X | X | X | 1000 μF |
| | Save | X | X | X | STBY |

Table 4. Adjustment Procedure (cont.)

| Test (Switch Position) | LCD Reading | 374 | 375 | 376 | Calibrator Output |
|---|----------------|-----|-----|-----|-------------------|
|  AC Amps (with 50-turn Coil) | C-23 | X | X | X | 8 A @ 50 Hz |
| | C-24 | X | X | X | 3 A @ 50 Hz |
| | C-25 | X | X | X | 3 A @ 100 Hz |
| | C-26 | X | X | X | 3 A @ 200 Hz |
| | C-27 | X | X | X | 3 A @ 300 Hz |
| | C-28 | X | X | X | 3 A @ 400 Hz |
| | C-29 | X | X | X | 3 A @ 440 Hz |
| | Save | X | X | X | STBY |
|  DC Amps (with 50-turn Coil) | C-30 | X | X | X | 0 A |
| | C-31 | X | X | X | 10 A |
| | Save | X | X | X | STBY |
|  Hz iFLEX Current Probe (Simulation) | C-32 | X | X | X | 60 mV @ 50 Hz |
| | C-33 | X | X | X | 30 mV @ 50 Hz |
| | C-34 | X | X | X | 60 mV @ 100 Hz |
| | C-35 | X | X | X | 120 mV @ 200 Hz |
| | C-36 | X | X | X | 180 mV @ 300 Hz |
| | C-37 | X | X | X | 240 mV @ 400 Hz |
| | C-38 | X | X | X | 300 mV @ 500 Hz |
| | Save | X | X | X | STBY |

Maintenance

Clean the Product


Caution

To prevent possible damage to the Product or to equipment under test, do not use abrasive cleaners. They will damage the case.

To clean the Product, use a cloth with a mild cleaning solution.

Battery Replacement

Warning

To prevent possible explosion, fire, or personal injury, replace the batteries when the low battery indicator () shows to prevent incorrect measurements.

Caution

To prevent possible damage to the Product or to equipment under test:

- Remove batteries to prevent battery leakage and damage to the Product if it is not used for an extended period.
- Be sure that the battery polarity is correct to prevent battery leakage.

To change the batteries, see Figure 5:

1. Make sure the Product is OFF.
2. Turn the Product over to access the battery compartment door screw.
3. Use a flat-head screwdriver to loosen the battery compartment door screw and lift off the battery compartment door.
4. Replace the two AA batteries.
5. Reattach the battery compartment door.
6. Tighten the battery compartment door screw.

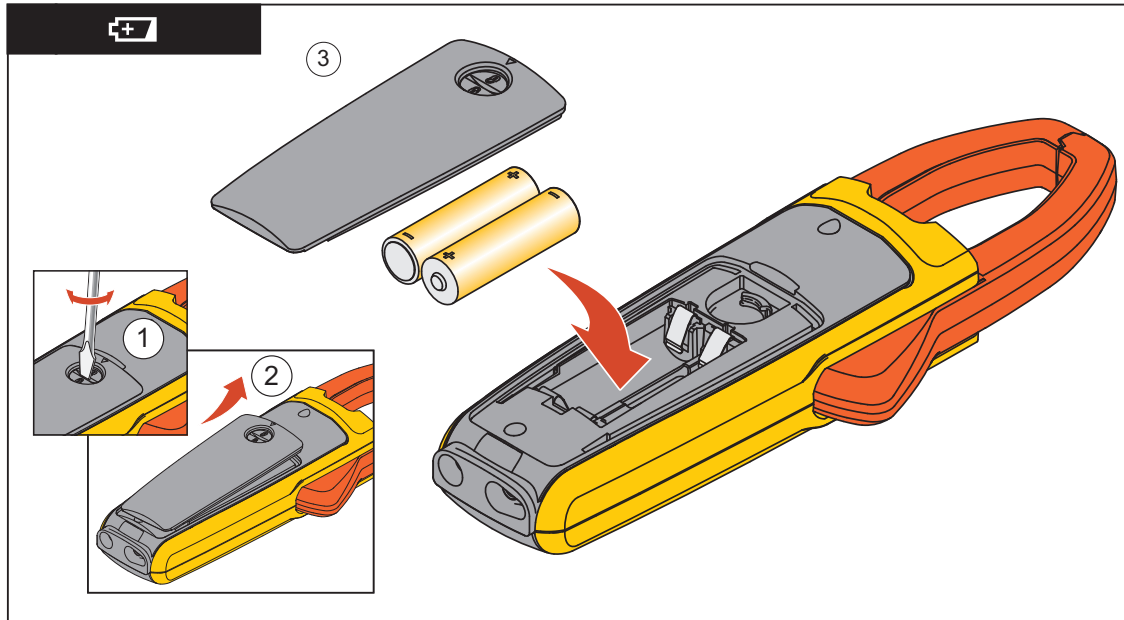


Figure 5. Changing the Batteries

fig11_12.eps

User Replaceable Parts

User replaceable parts are listed in Table 5.

Table 5. User Replaceable Parts

| Fluke Part Number | Description | Qty |
|-------------------|------------------------------|-----|
| 3845988 | Battery Door Assembly | 1 |
| 3752958 | Soft Case | 1 |
| 3608883 | User Manual | 1 |
| 376756 | Battery (AA 1.5V) | 2 |
| 3782019 | TL175 test leads | 1 |
| 855742 | TL75 test leads | 1 |
| 3798105 | Fluke i2500-18 Rogowski coil | 1 |
| 3868305 | Calibration Sticker | 1 |